PART NO. TTDCX90-EN-01

HITACHI

Reliable solutions

Technical Manual
Troubleshooting

ZX
200-5A
200LC-5A
210H-5A
210LCH-5A
210K-5A
210LCK-5A
210LCN-5A
Hydraulic Excavator

Service Manual consists of the following separate Part No.

Technical Manual (Operational Principle)	: Vol. No.TODCX90-EN
Technical Manual (Troubleshooting)	: Vol. No.TTDCX90-EN
Workshop Manual	: Vol. No.WDCX90-EN
Engine Manual	: Vol. No.ETDCY-EN, EWDCY-EN

MidWestTech | Hitachi ZX200-5A, ZX200LC-5A, ZX210H-5A, ZX210LCH-5A, ZX210K-5A, ZX210LCK-5A, ZX210LCN-5A Excavator Troubleshooting Technical Service Manual | Publication TTDCX90-EN-01

Order the manual at mid-west-tech.com >

SECTION 4

OPERATIONAL PERFORMANCE TEST

CONTENTS

Group 1 Introduction
Operational Performance Tests T4-1-1
Preparation for Performance Tests T4-1-2

Group 2 Standard
Operational Performance Standard Table T4-2-1
Main Pump P-Q Diagram (P1, P2) T4-2-10
Sensor Activating Range T4-2-12
MPDr. Monitor Indicating Values T4-2-14

Group 3 Engine Test
Engine Speed T4-3-1
Lubricant Consumption T4-3-4

Group 4 Machine Performance Test
Travel Speed T4-4-1
Track Revolution Speed T4-4-2
Mistrack Check T4-4-3
Travel Parking Leakage T4-4-4
Swing Speed T4-4-5
Swing Function Drift Check T4-4-6
Swing Motor Leakage T4-4-8
Maximum Swingable Slant Angle T4-4-10
Swing Bearing Play T4-4-12
Hydraulic Cylinder Cycle Time T4-4-14
Dig Function Drift Check T4-4-16
Control Lever Operating Force T4-4-19
Control Lever Stroke T4-4-20
Combined Operation of Boom Raise/ Swing Function Check T4-4-21
Combined Operation of Boom Raise/ Arm Roll-In Function Check T4-4-22
Clearance of Front Attachment Connecting Part T4-4-23

Group 5 Component Test
Primary Pilot Pressure T4-5-1
Secondary Pilot Pressure T4-5-3
3-Spool Solenoid Valve Set Pressure T4-5-4
Main Pump Delivery Pressure T4-5-7
Main Relief Set Pressure T4-5-8
Relief Pressure (when relieving swing) T4-5-12
Overload Relief Valve Set Pressure T4-5-14
Main Pump Flow Rate Measurement T4-5-16
Swing Motor Drainage T4-5-24
Travel Motor Drainage T4-5-26

MidWestTech | Hitachi ZX200-5A, ZX200LC-5A, ZX210H-5A, ZX210LCH-5A, ZX210K-... Order the manual at mid-west-tech.com >

MC Fault Codes 11008, 11010

Monitor Controller (Monitor) Fault Codes 13004, 13006, 13007

Preparation

- Check the wiring connections first.
- Check the CAN1 harness between the controllers. (Refer to CAN1 Harness Check on T5-6-54 to 56.)

Fault Code	Trouble	Inspection Method	Cause
11008-2	Monitor Controller (Information) Communication Error 2 (CAN1)	Continuity check (open circuit)	Open circuit in wire harness
		Discontinuity check (shorted circuit)	Shorted circuit in wire harness
11010-2	Monitor Controller (Monitor) Communication Error 2 (CAN1)	Continuity check (open circuit)	Open circuit in wire harness
		Discontinuity check (shorted circuit)	Shorted circuit in wire harness
13004-2	MC Communication Error 2	Continuity check (open circuit)	Open circuit in wire harness
		Discontinuity check (shorted circuit)	Shorted circuit in wire harness
13006-2	Monitor Controller (Information) Communication Error 2	Continuity check (open circuit)	Open circuit in wire harness
		Discontinuity check (shorted circuit)	Shorted circuit in wire harness
13007-2	Wiper/Light Controller Communication Error	Continuity check (open circuit)	Open circuit in wire harness
		Discontinuity check (shorted circuit)	Shorted circuit in wire harness


MidWestTech | Hitachi ZX200-5A, ZX200LC-5A, ZX210H-5A, ZX210LCH-5A, ZX210K-... Order the manual at mid-west-tech.com >

Troubleshooting B (Machine Diagnosis by Using Troubleshooting Symptom) Procedure

Refer to troubleshooting B procedures for diagnosis by using trouble symptom when no fault codes are displayed.

- Diagnosis Procedure
  - The diagnosis procedures for the displayed fault codes are explained in this group.
  - Perform diagnosis by using MPDr. or the service menu of monitor first.
  - In case any fault code has not been displayed by diagnosis, perform inspection according to the procedures when diagnosing.
  - When the fault code is displayed, refer to the troubleshooting A group and diagnose.
  - On the front section pages of this group, there are the tables indicating the relationship between machine trouble symptoms and related parts which may cause such trouble if failed. Start the troubleshooting with more probable causes selected by referring to these tables.

NOTE: All connector images in this section are viewed from the open end side of wire harness end.

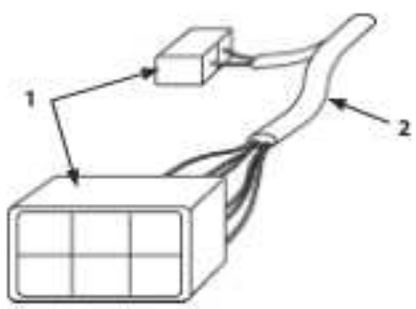

T6L4-05-03-001

1- Wire Harness End Connector 2- Wire Harness

MidWestTech | Hitachi ZX200-5A, ZX200LC-5A, ZX210H-5A, ZX210LCH-5A, ZX210K-... Order the manual at mid-west-tech.com >

Swing System Troubleshooting

S-1 Swing is slow or unmoving.

	Specification	Remark
Swing Speed (sec/3 rev)	13.5±1.0	The bucket should be empty

Preparation

- Check whether the pilot system is faulty or the main circuit is faulty.
- If other functions (front attachment and travel) are operated normally, the pilot pump (primary pilot pressure) is considered to be normal. If the pilot system is faulty, the cause of trouble may exist in the circuit downstream of the pilot valve.
- In case travel (left) is also slow, also refer to A-3.

Procedure	Inspection Method	Condition	Evaluation	Cause
1	Monitor Swing Pilot Pressure.	Fully swing	The measured values are not within the specification. (Specification: 3.4-4.0 MPa)	Faulty pilot valve
2	Monitor Pump 2 Control Pressure.	Fully swing	The measured values are not within the specification. (Specification: 2.9-3.9 MPa)	Stuck pump 2 flow rate control valve in signal control valve
3	Monitor Front ATT Pilot Pressure.	When relieving arm	The measured values are not within the specification. (Specification: 3.5-5.0 MPa)	Faulty swing parking brake release spool in signal control valve
4	Disassemble and inspect the parking brake release valve in the swing motor.	-	There is abnormality.	Faulty swing parking brake release valve
5	Monitor Pump 2 Delivery Pressure.	When relieving swing	The measured values are not within the specification. (Specification: 32.8-35.6 MPa)	Faulty swing relief valve
6	Measure the swing motor drainage.	With constant speed	The measured values are not within the specification. (Specification: 0.2-0.5 L/min)	Faulty swing motor
7	-	-	The check mentioned above is normal.	Faulty swing reduction gear

MidWestTech | Hitachi ZX200-5A, ZX200LC-5A, ZX210H-5A, ZX210LCH-5A, ZX210K-... Order the manual at mid-west-tech.com >