ATLET

WAREHOUSE EQUIPMENT

PLL PSD PSL PLE

SERVICE MANUAL

Manual number 119000

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet Truc... Order the manual at mid-west-tech.com >

SERVICE MANUAL

Machine: *PLL PSD PSL PLE*

Manual No: *119000*

Edition 2008B

1 General information and technical data

Scope of Service Manual **1.3**
General 1.3
Scope of the P series 1.3

How to use the manual **1.4**
Structure 1.4
Symbol key 1.4

Safety instructions **1.5**
General 1.5
Lifting the truck 1.6
Inspection/Preparation 1.6
Permitted lifting points 1.6
Welding on the truck 1.8
Atlet AB takes care of the environment 1.8
Environmental impact 1.8
Waste 1.8

Preparations **1.9**
Service 1.9
Trouble shooting 1.9

Data PLL, PSD **1.10**
Designations 1.10
Truck designation 1.10
Type designation 1.11
Dimensions and weights 1.14
Component specification 1.16

Recommended consumable materials **1.17**
Oil and grease 1.17

Standards and abbreviations **1.18**

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet... Order the manual at mid-west-tech.com >

Screws 1.18
Tightening torque, screws and nuts 1.18
Tightening torque, hydraulic couplings 1.19
Conversion tables 1.19
Standard abbreviations 1.20
..... 1.21
Screw types and tensile grades 1.21
Colour of the truck 1.22
Colour codes, cabling 1.22
Designations 1.23

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet... Order the manual at mid-west-tech.com >

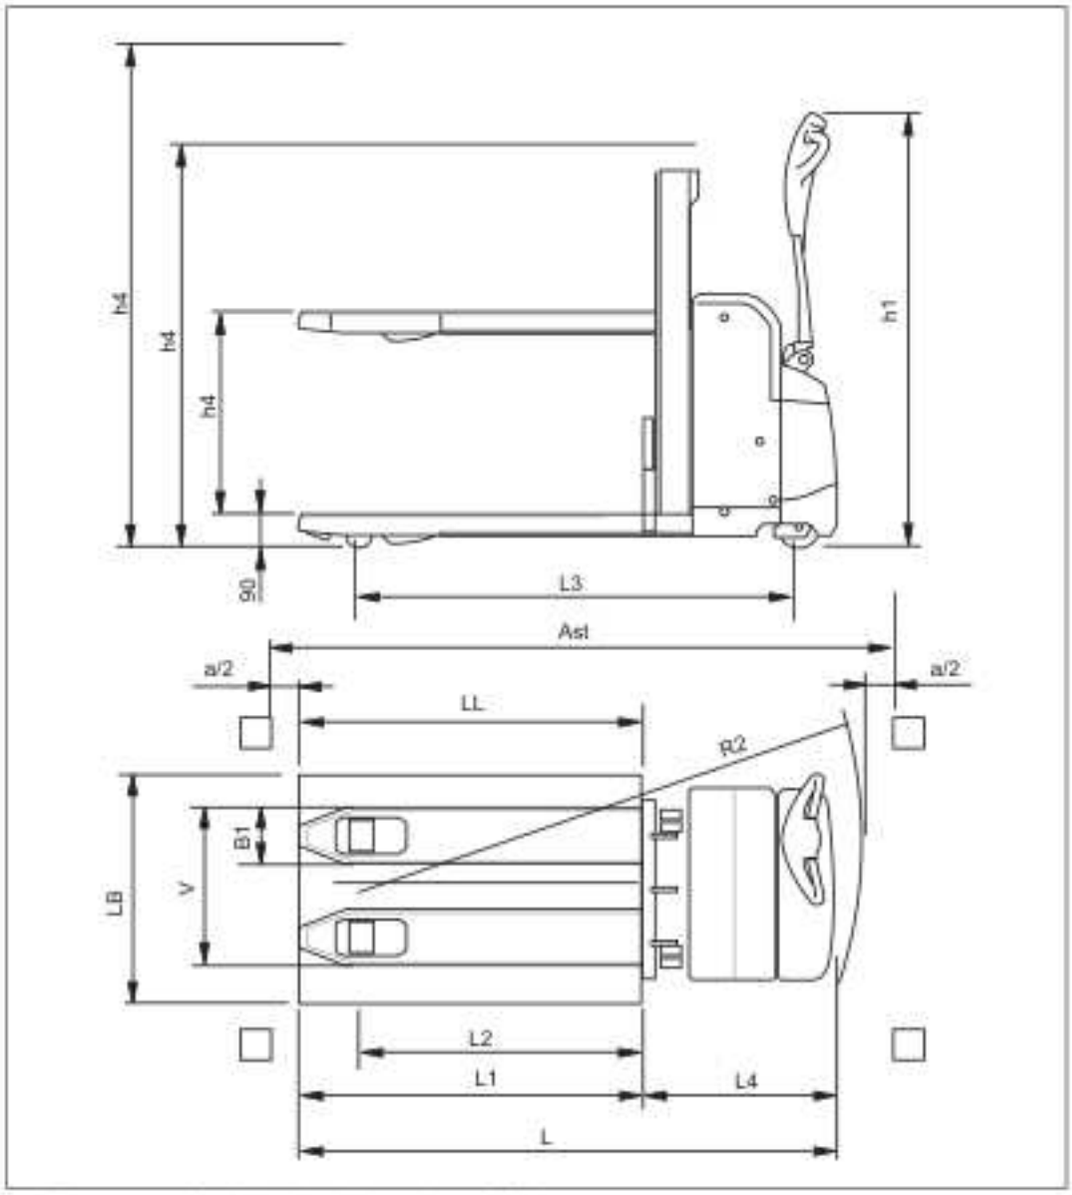


Figure 1.7 Positions for dimensions PSD

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet... Order the manual at mid-west-tech.com >

Table 10.2

Error code indicating	Class	Explanation	Control/Procedure
E122 TMC motor temperature	Warning C	The drive motor temperature has exceeded the warning level.	1. See trouble shooting for "High temperature in drive motor E122" on page 10.61.
E123 TMC generic	Warning C	Generic warning	Try restarting a few times. If the error does not disappear, change TMC. **NOTE! The error is probably logged together with E115, but should normally never occur. If E115 or E123 are still be logged, this should be reported to the service function at ATLET AB**
E124 TMC PEV output	B	The output to lowering valve Y2 connection X6.11 is defective	First confirm that the valve coil is not short-circuited, that the freewheel diode short-circuits or is reversed, or that there is a short-circuit in the cabling. **NOTE! This output connects to B+ and is not short-circuit-proof. For this reason make sure to check that no external short-circuit exists before changing TMC.**
E125 TMC temperature sensor	Warning C	The internal temperature sensor is defective	Change TMC
E126 TMC Temperature sensor drive motor	Warning C	The drive motor temperature sensor is defective	First check trouble shooting for "High temperature in drive motor E122" on page 10.61.
E127 TMC Current sensor error	C	Current calibration in progress	Try restarting a few times. If this does not help, change TMC.

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet... Order the manual at mid-west-tech.com >

MDI AND MDI - PRC

MDI Connection

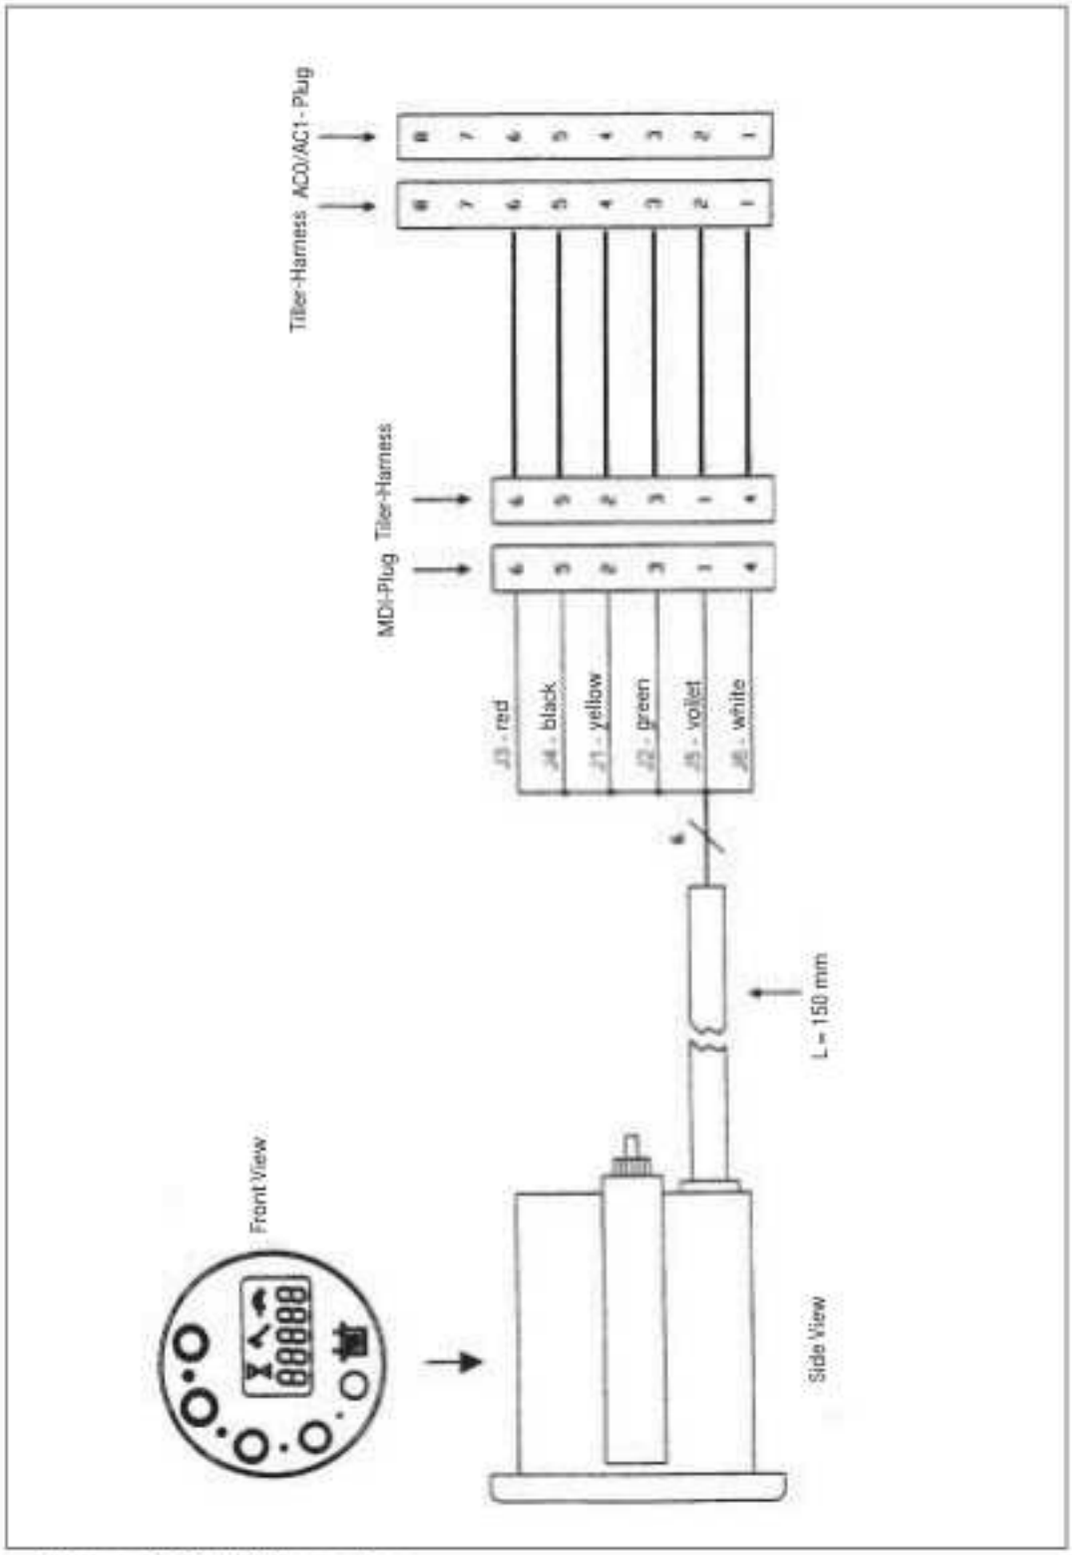


Figure 10.10 MDI Connection

MidWestTech | ATLET PLL 145, PLL 180, PLL 200, PSD 125/160, PSL 125, PLE Pallet... Order the manual at mid-west-tech.com >