2094, 2294, 3294
Tractor


Service Manual

8-24901

MidWestTech | Case 2094, 2294, 3294 Tractor Service Manual | Publication 8-24901

Order the manual at mid-west-tech.com >

Scored Thrust Collar

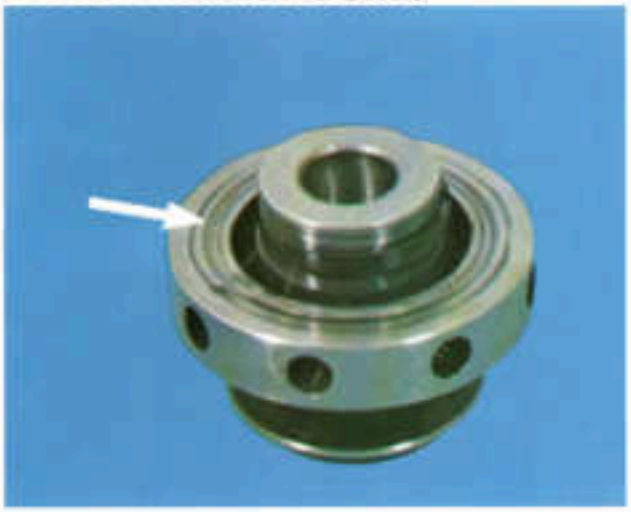

Scoring on the thrust collar caused by dirty oil usually because engine oil and/or oil filters were not changed at the recommended intervals.

Compressor Damage - Soft



Soft material getting into the inlet will damage the compressor blades as shown. The damage to this blade was caused by a shop towel being left in the intake system.


Compressor Damage - Hard






Hard material such as a nut, wire, wrench or bolt getting into the inlet will damage the compressor blades as shown. The compressor housing will be marked by the bits of foreign material. If damage to blades is so extensive that wheel balance is destroyed, some wheel-to-housing contact damage may also be present.

Order the manual at mid-west-tech.com >

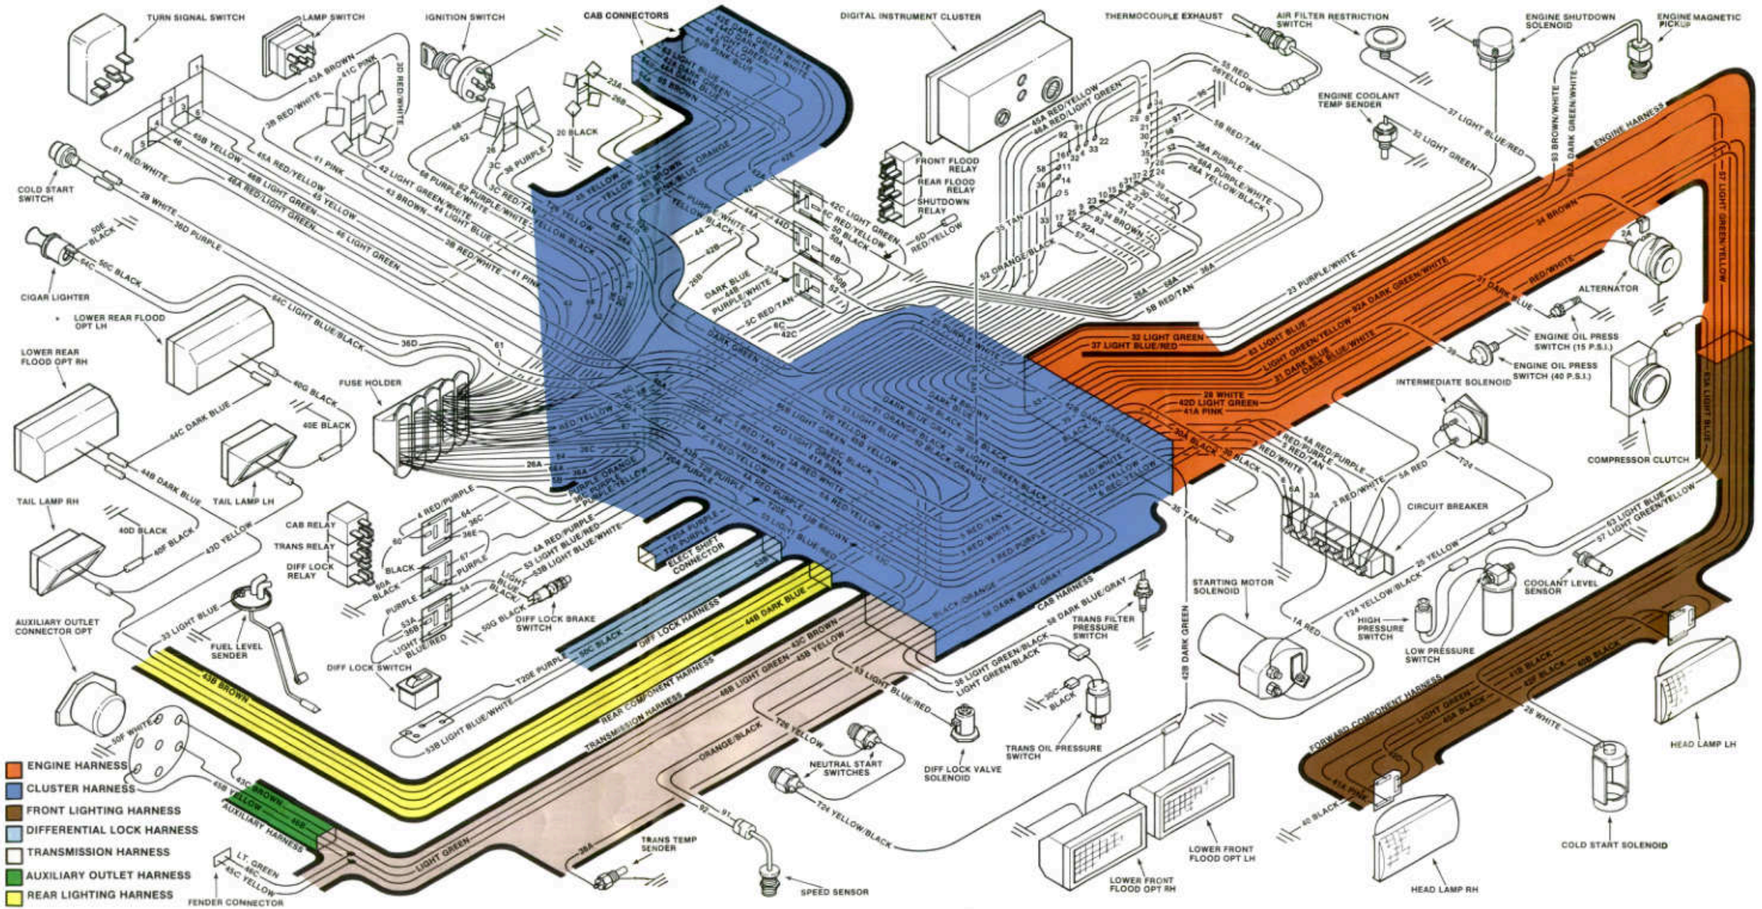

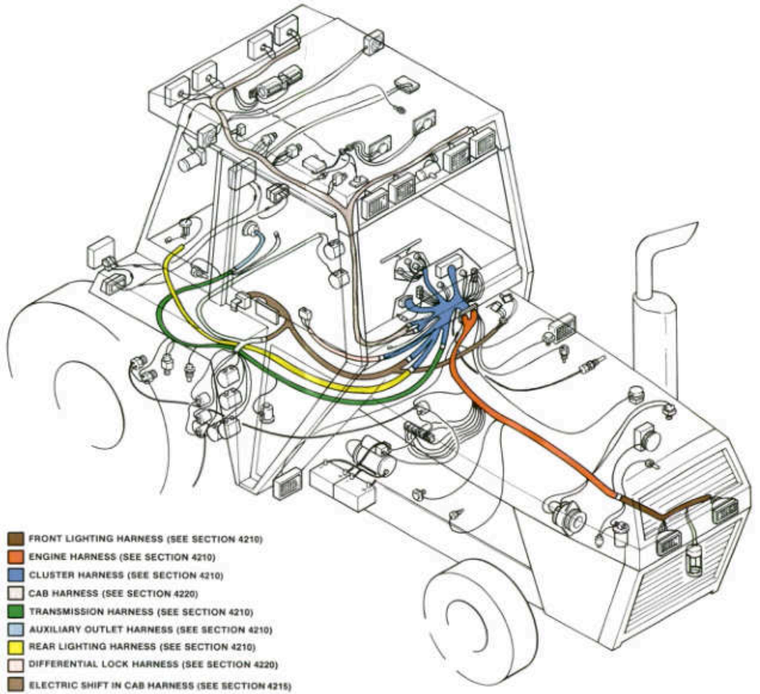

- FRONT LIGHTING HARNESS (SEE SECTION 4210)
- ENGINE HARNESS (SEE SECTION 4210)
- CLUSTER HARNESS (SEE SECTION 4210)
- CAB HARNESS (SEE SECTION 4220)
- TRANSMISSION HARNESS (SEE SECTION 4210)
- AUXILIARY OUTLET HARNESS (SEE SECTION 4210)
- REAR LIGHTING HARNESS (SEE SECTION 4210)
- DIFFERENTIAL LOCK HARNESS (SEE SECTION 4220)
- ELECTRIC SHIFT IN CAB HARNESS (SEE SECTION 4215)
- ELECTRIC SHIFT EXTERIOR HARNESS (SEE SECTION 4215)

Rac 8-24360

Order the manual at mid-west-tech.com >